### **Air Monitoring Summary Tables**

The table below summarizes monitoring data collected using a portable wireless remote monitoring system. All times in Eastern Standard Time (EST).

From: 11/10/23 12:00 am To: 11/10/23 11:59 pm

Offsite Monitors

Instrument	Analyte	ATSDR MRL 14-day Avg Reached?	Concentration Range Detected <sup>a</sup>	24-hr Average <sup>a</sup>	7-day Average	ATSDR 14-day MRL		
Catawba Headstart								
Acrulog PPB	$H_2S$	No	0-0 ppb	0.00 ppb <sup>b</sup>	1.09 ppb	70 ppb		
Treetops								
Acrulog PPB	$H_2S$	No	0-0 ppb	0.00 ppb <sup>c</sup>	0.00 ppb	70 ppb		
Liberty Hill								
Acrulog PPB	$H_2S$	No $0-0$ ppb		0.00 ppb <sup>d</sup>	0.05 ppb	70 ppb		
Riverchase Estates								
Acrulog PPB	$H_2S$	No	0-0 ppb	0.00 ppb <sup>e</sup>	1.04 ppb	70 ppb		
Millstone Creek								
Acrulog PPB	$H_2S$	No	0-0 ppb	0.00 ppb <sup>f</sup>	0.00 ppb	70 ppb		

<sup>&</sup>lt;sup>b</sup> The 24-hr average at Catawba Headstart is not represented by the full 24-hr period; a total of 1 30-minute average is missing from the reported period due to routine QC-checks performed at this location.

#### **Onsite Fenceline Monitors**

Instrument	Analyte	30-min AEGL Reached?	Concentration Range Detected <sup>a</sup>	24-hr Average <sup>a</sup>	7-day Average	30-min AEGL	
Station 1							
TAPI Analyzer	$H_2S$	No	0 – 10 ppb 1.59 ppb		5.51 ppb	600 ppb	
Station 2							
TAPI Analyzer	$H_2S$	No	0 − 14 ppb	1.25 ppb	1.07 ppb	600 ppb	
Station 3							
TAPI Analyzer	$H_2S$	No	0 – 19 ppb	1.79 ppb	2.71 ppb	600 ppb	

<sup>&</sup>lt;sup>a</sup> Based on 30-minute averages.

#### **Notes:**

ATSDR MRL Agency for Toxic Substances and Disease Registry Minimal Risk Level (MRL)

AEGL EPA Acute Exposure Guidelines Levels

H<sub>2</sub>S Hydrogen Sulfide

TAPI Teledyne API H<sub>2</sub>S Analyzer

hr Hour
min Minute
ppb Parts per billion

MRL Limit Limit defined as a 14-day average value.


<sup>&</sup>lt;sup>c</sup> The 24-hr average at Treetops is not represented by the full 24-hr period; a total of 1 30-minute average is missing from the reported period due to routine QC-checks performed at this location.

<sup>&</sup>lt;sup>d</sup> The 24-hr average at Liberty Hill is not represented by the full 24-hr period; a total of 1 30-minute average is missing from the reported period due to routine QC-checks performed at this location.

<sup>&</sup>lt;sup>e</sup> The 24-hr average at Riverchase Estates is not represented by the full 24-hr period; a total of 1 30-minute average is missing from the reported period due to routine QC-checks performed at this location.

<sup>&</sup>lt;sup>f</sup> The 24-hr average at Millstone Creek is not represented by the full 24-hr period; a total of 1 30-minute average is missing from the reported period due to routine QC-checks performed at this location.

Station 1 Wind Rose – Shows the direction the wind is coming from, the monitoring station being at the center of the rose.

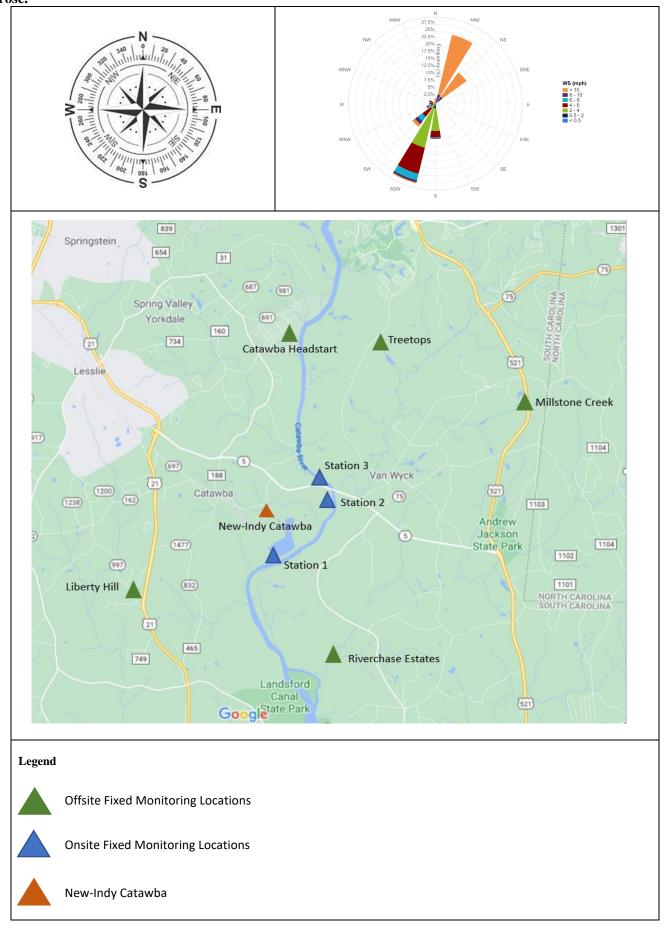


#### Period H<sub>2</sub>S Monitoring Hydrogen Sulfide Offsite Monitors

Below are graphs for offsite locations where hydrogen sulfide (H<sub>2</sub>S) was detected during the current reporting period.


The five stand-alone H<sub>2</sub>S monitoring stations correlate with five previous EPA's Viper monitoring system which includes areas to the north-northeast and south-southwest of the New-Indy Catawba Mill.

Winds were coming from a variable direction throughout the day at 2 to 16 mph.


See wind rose diagram with aerial map figure for full wind data during this reporting period.

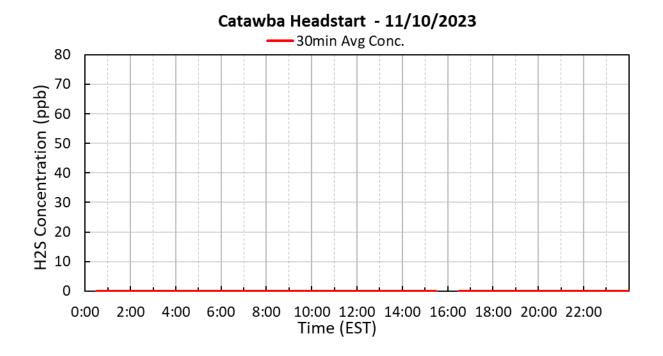


# Treetops - 11/10/2023

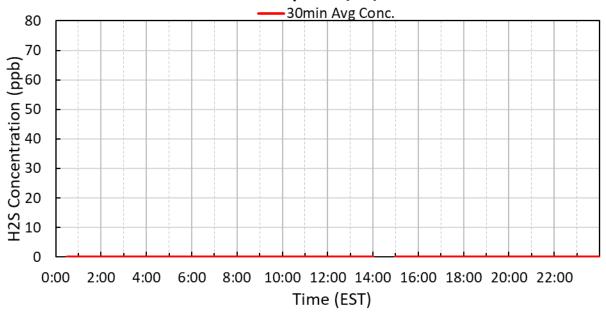


## Liberty Hill - 11/10/2023

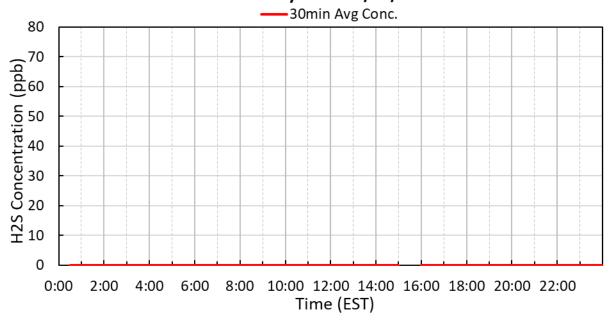

# Riverchase - 11/10/2023

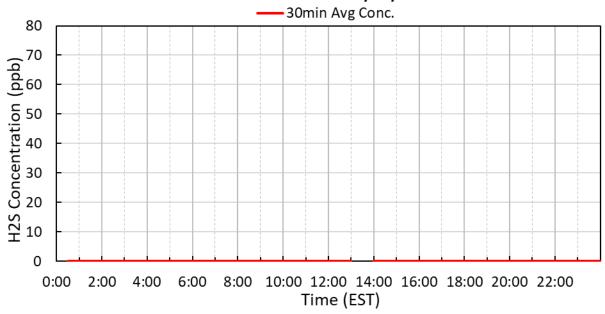

# Millstone Creek - 11/10/2023

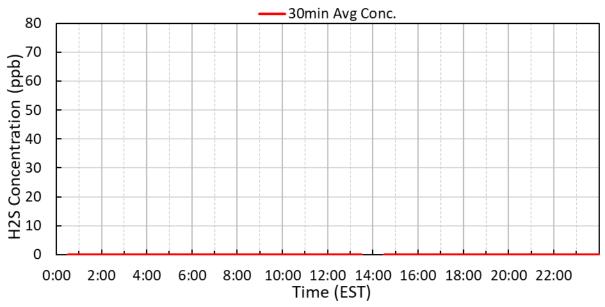


### Period H<sub>2</sub>S Monitoring Hydrogen Sulfide Onsite Monitors


Below are graphs for onsite locations during the current reporting period.


Depending on wind direction, the H<sub>2</sub>S measured at the onsite fence line locations may not exit the mill property at reported concentrations. Wind directions from offsite locations, blowing onto mill property, will disperse ambient concentrations to lower levels prior to exiting the plant site.


Winds were coming from a variable direction throughout the day at 2 to 16 mph.

See wind rose diagram with aerial map figure for full wind data during this reporting period.

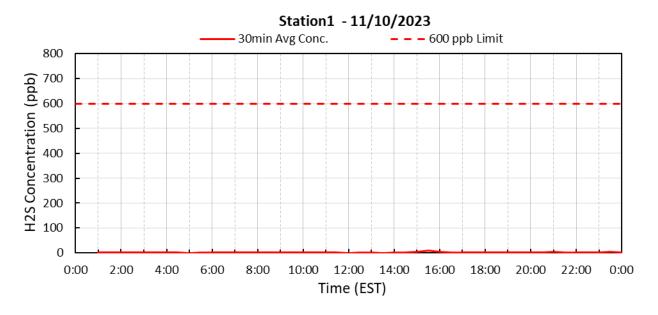

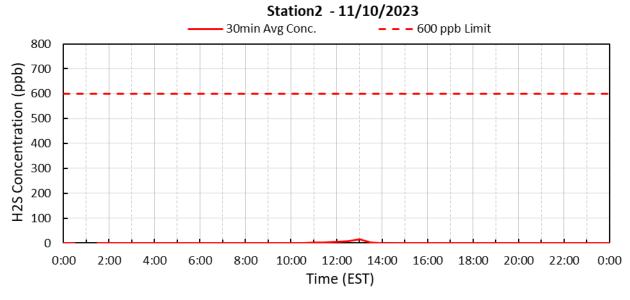



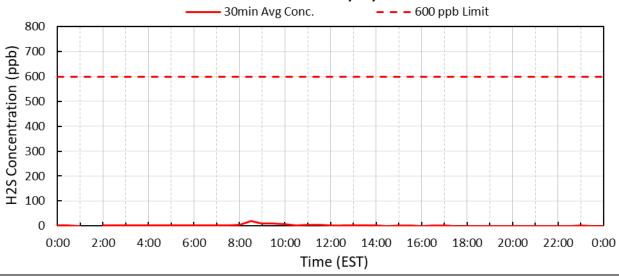

# Submitted Fenceline $H_2S$ and Met 30-minute Data

	Station 1		Station 2			Station 3			
30-Minute Avgs	H2S Met		H2S Met		H2S Met				
11/10/2023	30min Avg H2S Conc.	30min Avg WS	30min Avg WD	30min Avg H2S Conc.	30min Avg WS	30min Avg WD	30min Avg H2S Conc.	30min Avg WS	30min Avg WD
Date / Time	ppb	mph	degrees		mph	degrees	ppb	mph	degrees
-	1		<u> </u>	ppb	<del> </del>				
11/10/2023 0:30	AX	3.8	196	0.5	1.2	186	1.1	1.3	180
11/10/2023 1:00	0.6	3.7	188	AX	1.4	184	0.4	0.8	180
11/10/2023 1:30	0.5	3.2	193	0.8	1.5	180	AX	1.1	189
11/10/2023 2:00	0.4	3.1	194	0.7	1.2	156	0.7	0.8	169
11/10/2023 2:30	0.9	2.5	189	0.7	0.7	130	0.6	0.3	157
11/10/2023 3:00	0.8	2.0	189	0.7	0.7	105	0.7	0.2	189
11/10/2023 3:30	0.4	2.1	195	0.6	0.7	79	0.7	0.3	155
11/10/2023 4:00	1.7	3.0	189	0.6	0.5	78	0.7	0.4	182
11/10/2023 4:30	0.7	4.0	195	0.6	0.6	58	0.6	0.3	164
11/10/2023 5:00	0.2	3.3	202	0.7	0.6	46	0.7	0.4	163
11/10/2023 5:30	0.7	2.5	202	0.7	0.5	102	0.7	0.7	173
11/10/2023 6:00	1.5	2.7	198	0.7	0.5	150	0.7	0.7	167
11/10/2023 6:30	0.5	4.1	204	0.7	0.8	216	0.8	0.7	187
11/10/2023 7:00	1.4	4.0	197	0.6	0.8	166	2.8	1.0	177
11/10/2023 7:30	1.0	4.2	194	0.6	1.1	196	0.8	1.7	189
11/10/2023 8:00	1.5	4.7	205	0.6	2.4	220	4.7	2.2	199
11/10/2023 8:30	1.3	4.7	208	0.6	2.8	223	18.8	2.4	205
11/10/2023 9:00	1.2	4.9	213	0.6	3.5	219	10.1	2.8	201
11/10/2023 9:30	1.0	5.3	212	0.7	3.6	223	9.3	2.2	197
11/10/2023 10:00	1.1	5.4	197	0.6	3.9	212	6.1	2.9	193
11/10/2023 10:30	1.0	6.3	202	0.6	4.6	208	1.8	3.2	202
11/10/2023 11:00	0.5	7.8	221	1.5	6.3	229	5.0	3.9	236
11/10/2023 11:30	0.4	9.4	224	1.5	7.9	237	4.6	3.2	239
11/10/2023 12:00	0.2	7.7	227	5.6	6.3	235	2.1	3.0	252
11/10/2023 12:30	0.4	6.1	235	7.0	6.8	237	0.9	3.6	253
11/10/2023 13:00	0.5	5.1	240	14.1	5.8	245	0.6	2.3	270
11/10/2023 13:30	0.2	4.5	277	3.6	4.1	275	0.5	0.8	295
11/10/2023 14:00	0.4	3.8	285	1.0	3.6	278	0.5	0.5	294
11/10/2023 14:30	0.7	7.1	332	0.7	4.1	329	0.4	2.5	345
11/10/2023 15:00	3.1	15.5	4	0.7	5.4	3	0.5	6.5	5
11/10/2023 15:30	9.8	14.1	21	0.7	4.5	32	0.5	4.9	26
11/10/2023 16:00	5.4	15.1	28	0.6	3.7	38	0.4	5.3	28
11/10/2023 16:30	1.9	14.6	38	0.6	3.8	44	0.5	4.1	38
11/10/2023 17:00	2.2	11.7	33	0.5	2.8	40	0.5	3.2	35
11/10/2023 17:30	1.9	11.9	34	0.5	2.1	55	0.4	3.3	44
11/10/2023 18:00	2.7	14.1	29	0.7	3.0	42	0.2	4.1	32
11/10/2023 18:30	2.0	12.4	33	0.6	2.3	50	0.2	4.1	39
11/10/2023 19:00	1.6	11.4	35	0.7	2.6	49	0.4	3.7	37
11/10/2023 19:30	2.0	12.5	31	0.7	2.7	39	0.4	3.9	35
11/10/2023 20:00	2.3	13.0	28	0.7	2.8	46	0.4	4.5	31
11/10/2023 20:30	1.7	12.7	31	0.5	2.4	44	0.4	3.8	29
11/10/2023 21:00	4.2	13.2	26	0.4	3.0	36	0.2	4.1	33
11/10/2023 21:30	1.8	12.6	30	0.5	2.7	38	0.2	4.0	39
11/10/2023 22:00	0.9	9.5	38	0.5	2.1	44	0.4	2.9	31
11/10/2023 22:30	2.1	11.2	26	0.5	2.5	36	0.2	3.3	33
11/10/2023 23:00	1.7	10.0	31	0.5	2.4	35	0.5	3.1	29
11/10/2023 23:30	4.4	10.0	26	0.5	2.1	37	0.2	3.0	36
11/11/2023 0:00	1.3	9.9	32	0.5	1.8	44	0.2	3.0	37

AQS Null Data Codes					
Qualifier Code	Item Description				
AB	TECHNICIAN UNAVAILABLE				
AC	CONSTRUCTION/REPAIRS IN AREA				
AD	SHELTER STORM DAMAGE				
AE	SHELTER TEMPERATURE OUTSIDE LIMITS				
AI	INSUFFICIENT DATA (CAN'T CALCULATE)				
AM	MISCELLANEOUS VOID				
AN	MACHINE MALFUNCTION				
AO	BAD WEATHER				
AP	VANDALISM				
AS	POOR QUALITY ASSURANCE RESULTS				
AT	CALIBRATION				
AU	MONITORING WAIVED				
AV	POWER FAILURE (POWR)				
AW	WILDLIFE DAMAGE				
AX	PRECISION CHECK (PREC)				
AY	Q C CONTROL POINTS (ZERO/SPAN)				
AZ	Q C AUDIT (AUDT)				
BA	MAINTENANCE/ROUTINE REPAIRS				
BB	UNABLE TO REACH SITE				
BC	MULTI-POINT CALIBRATION				
BD	AUTO CALIBRATION				
BE	BUILDING/SITE REPAIR				
BF	PRECISION/ZERO/SPAN				
BJ	OPERATOR ERROR				
BK	SITE COMPUTER/DATA LOGGER DOWN				
EC	EXCEED CRITICAL CRITERIA				