Air Monitoring Summary Tables

The table below summarizes monitoring data collected using a portable wireless remote monitoring system. All times in Eastern Standard Time (EST).

From: 12/22/23 12:00 am To: 12/22/23 11:59 pm

Offsite Monitors

Instrument	Analyte	ATSDR MRL 14-day Avg Reached?	Concentration Range Detected ^a	24-hr Average ^a	7-day Average	ATSDR 14-day MRL	
Catawba Headstart							
Acrulog PPB	H_2S	No 0 – 0 ppb 0.00 ppb ^b		0.00 ppb	70 ppb		
Treetops							
Acrulog PPB	H_2S	No 0 - 0 ppb 0.00 ppb c 0.0		0.00 ppb	70 ppb		
Liberty Hill							
Acrulog PPB	H_2S	No	0-0 ppb	0.00 ppb ^d	0.00 ppb	70 ppb	
Riverchase Estates							
Acrulog PPB	H_2S	No	No $0-0 \text{ ppb}$ $0.00 \text{ ppb}^{\text{ e}}$		0.01 ppb	70 ppb	
Millstone Creek	Millstone Creek						
Acrulog PPB	H_2S	No	0-0 ppb	0.00 ppb ^f	0.00 ppb 70 ppb		

^b The 24-hr average at Catawba Headstart is not represented by the full 24-hr period; a total of 1 30-minute average is missing from the reported period due routine QC checks performed at this location.

Onsite Fenceline Monitors

Instrument	Analyte	30-min AEGL Reached?	Concentration Range Detected a 24-hr Average a		7-day Average	30-min AEGL	
Station 1							
TAPI Analyzer	H_2S	No	0 – 2 ppb 0.48 ppb		1.73 ppb	600 ppb	
Station 2							
TAPI Analyzer	H_2S	No	0-3 ppb	0.92 ppb ^g	0.81 ppb	600 ppb	
Station 3							
TAPI Analyzer	H_2S	No	1 – 6 ppb	1.83 ppb	1.03 ppb	600 ppb	

^a Based on 30-minute averages.

Notes:

ATSDR MRL Agency for Toxic Substances and Disease Registry Minimal Risk Level (MRL)

AEGL EPA Acute Exposure Guidelines Levels

H₂S Hydrogen Sulfide

TAPI Teledyne API H₂S Analyzer

hr Hour
min Minute
ppb Parts per billion

MRL Limit Limit defined as a 14-day average value.

^c The 24-hr average at Treetops is not represented by the full 24-hr period; a total of 1 30-minute average is missing from the reported period due routine QC checks performed at this location.


^ad The 24-hr average at Liberty Hill is not represented by the full 24-hr period; a total of 1 30-minute average is missing from the reported period due routine QC checks performed at this location.

e The 24-hr average at Riverchase Estates is not represented by the full 24-hr period; a total of 2 30-minute averages are missing from the reported period due routine QC checks performed at this location.

The 24-hr average at Millstone Creek is not represented by the full 24-hr period; a total of 1 30-minute average is missing from the reported period due routine QC checks performed at this location.

g The 24-hr average at Station 2 is not represented by the full 24-hr period; a total of 3 30-minute averages are missing from the reported period due to a follow-up QC check performed at this location.

Station 1 Wind Rose – Shows the direction the wind is coming from, the monitoring station being at the center of the rose.

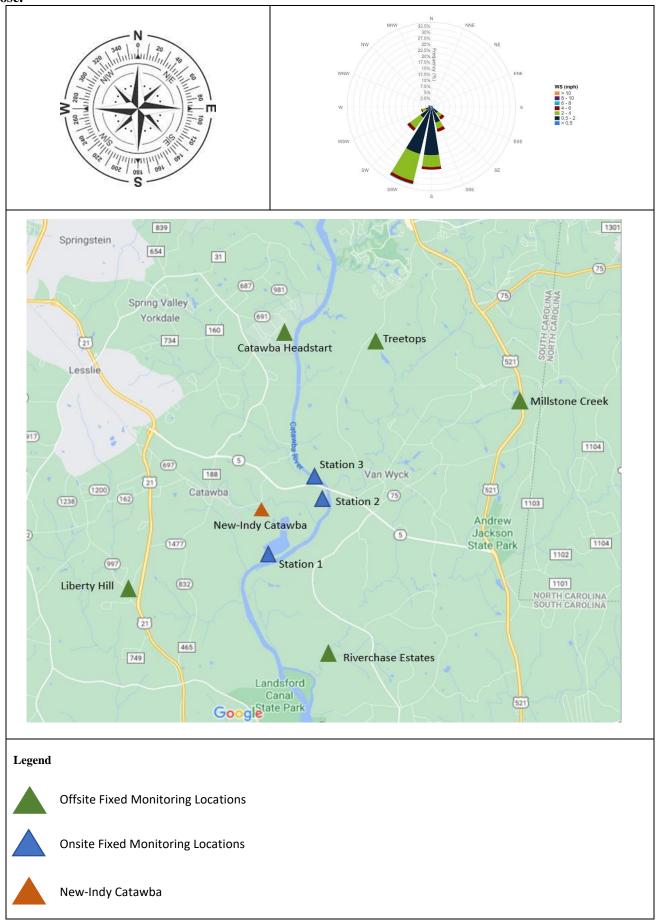


Period H₂S Monitoring Hydrogen Sulfide Offsite Monitors

Below are graphs for offsite locations where hydrogen sulfide (H₂S) was detected during the current reporting period.


The five stand-alone H₂S monitoring stations correlate with five previous EPA's Viper monitoring system which includes areas to the north-northeast and south-southwest of the New-Indy Catawba Mill.

Winds were predominantly coming from the southwest, south-southwest, south and south-southeast direction throughout the day at 1 to 5 mph.


See wind rose diagram with aerial map figure for full wind data during this reporting period.

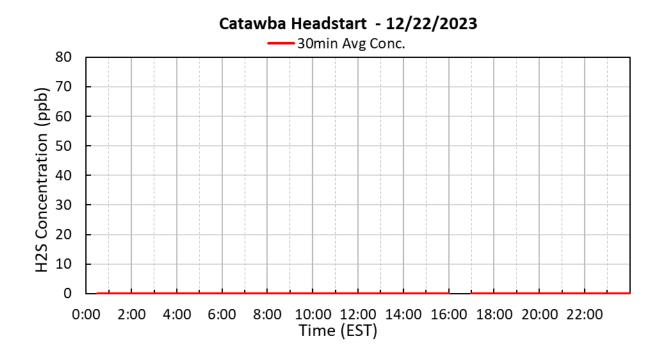

Treetops - 12/22/2023 ——30min Avg Conc.

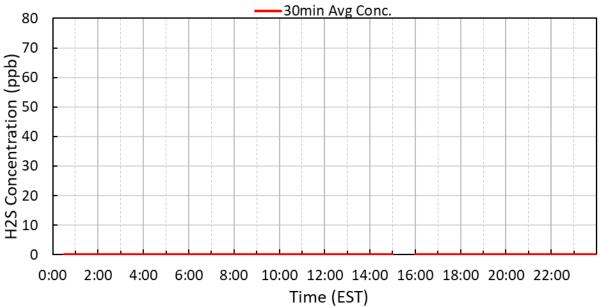


Liberty Hill - 12/22/2023

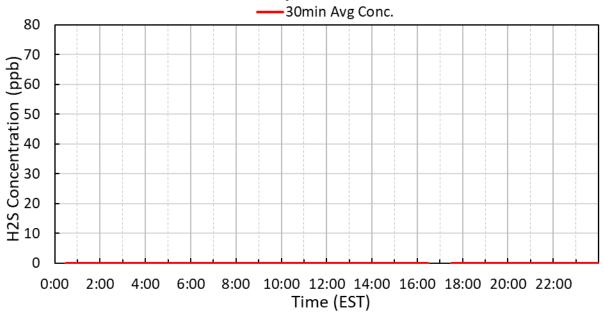

Riverchase - 12/22/2023

Millstone Creek - 12/22/2023

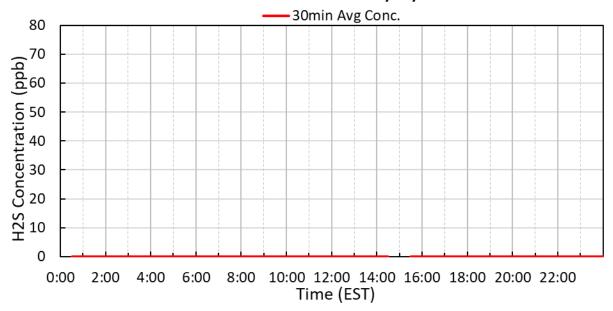


Period H₂S Monitoring Hydrogen Sulfide Onsite Monitors


Below are graphs for onsite locations during the current reporting period.


Depending on wind direction, the H_2S measured at the onsite fence line locations may not exit the mill property at reported concentrations. Wind directions from offsite locations, blowing onto mill property, will disperse ambient concentrations to lower levels prior to exiting the plant site.

Winds were predominantly coming from the southwest, south-southwest, south and south-southeast direction throughout the day at 1 to 5 mph.

See wind rose diagram with aerial map figure for full wind data during this reporting period.

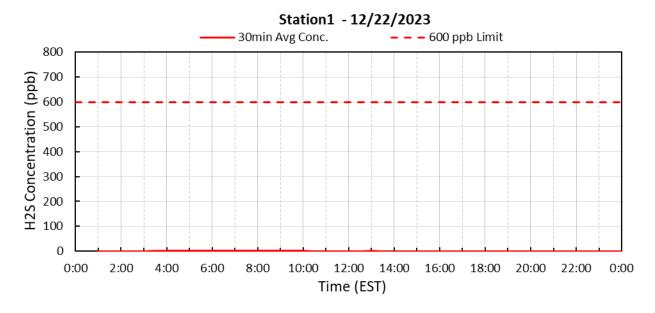

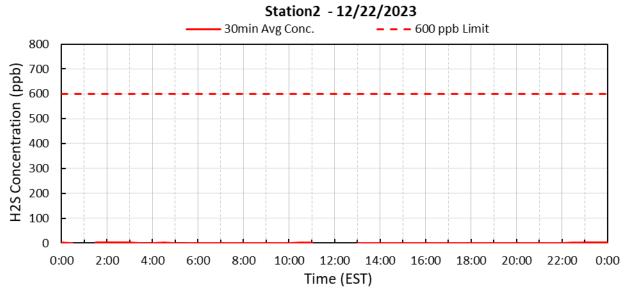

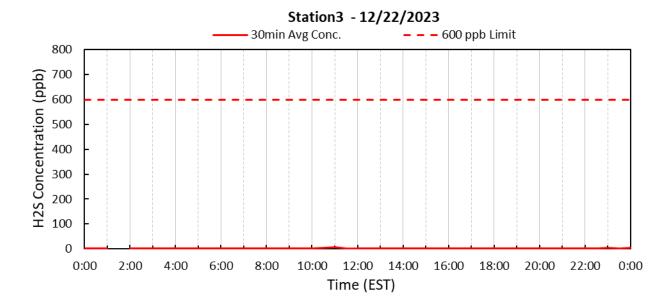

Submitted Fenceline H_2S and Met 30-minute Data

	Station 1		Station 2			Station 3			
30-Minute Avgs	H2S	М	et	H2S	М	et	H2S	M	et
10/00/0000	20	20	20	20	20	20	20	20	20
12/22/2023	30min Avg H2S Conc.	WS WS	30min Avg WD	30min Avg	30min Avg WS	30min Avg WD	30min Avg	WS WS	30min Avg WD
Data / Time				H2S Conc.			H2S Conc.		
Date / Time	ppb	mph	degrees	ppb	mph	degrees	ppb	mph	degrees
12/22/2023 0:30	AX	1.2	192	0.8	0.4	22	2.1	0.3	341
12/22/2023 1:00	0.2	1.6	187	AX	0.4	15	2.1	0.2	330
12/22/2023 1:30	0.2	1.5	194	1.1	0.9	3	AX	0.3	313
12/22/2023 2:00	0.2	0.9	180	1.3	0.7	30	2.5	0.2	10
12/22/2023 2:30	0.2	1.3	182	1.2	0.5	20	2.0	0.2	316
12/22/2023 3:00	0.2	1.5	190	1.1	0.6	353	1.6	0.3	328
12/22/2023 3:30	0.4	0.8	199	0.8	0.7	17	1.9	0.3	328
12/22/2023 4:00	0.6	1.4	179	1.0	0.4	328	2.0	0.2	251
12/22/2023 4:30	0.8	1.1	194	1.1	0.7	357	1.6	0.3	332
12/22/2023 5:00	0.7	1.0	204	0.9	0.7	10	1.6	0.2	291
12/22/2023 5:30	0.7	1.0	171	1.0	0.5	30	1.8	0.3	360
12/22/2023 6:00	0.8	0.5	150	1.0	0.9	0	1.6	0.2	306
12/22/2023 6:30	0.7	1.0	175	0.8	0.5	14	1.6	0.3	124
12/22/2023 7:00	0.9	0.8	208	0.8	0.6	345	1.7	0.4	343
12/22/2023 7:30	1.4	1.7	229	0.8	0.7	329	1.6	0.7	231
12/22/2023 8:00	2.1	1.3	224	0.8	1.3	36	1.8	0.8	15
12/22/2023 8:30	2.0	1.3	166	1.0	1.1	26	1.6	0.7	37
12/22/2023 9:00	2.2	1.2	195	0.9	1.1	270	1.9	0.7	167
12/22/2023 9:30	2.0	2.1	233	0.9	1.2	226	2.3	0.4	153
12/22/2023 10:00	0.6	2.0	226	0.7	1.3	216	2.1	1.1	199
12/22/2023 10:30	0.2	1.2	219	2.8	1.3	89	5.1	1.0	42
12/22/2023 11:00	0.2	1.2	169	3.1	1.0	221	6.3	0.9	78
12/22/2023 11:30	0.2	1.5	144	AX	0.8	145	2.7	1.0	79
12/22/2023 12:00	0.2	1.8	211	AX	2.6	224	1.3	0.7	308
12/22/2023 12:30	0.2	2.8	221	AX	2.1	235	2.4	1.9	190
12/22/2023 13:00	0.4	3.8	222	0.8	3.9	230	1.1	1.9	204
12/22/2023 13:30	0.2	4.5	207	1.0	4.5	244	1.2	2.5	215
12/22/2023 14:00	0.2	2.7	210	0.6	3.1	228	1.0	1.9	222
12/22/2023 14:30	0.2	2.8	189	0.6	2.5	218	1.0	2.0	171
12/22/2023 15:00	0.2	3.6	191	0.6	2.5	230	1.0	1.8	192
12/22/2023 15:30	0.2	3.4	179	0.6	3.0	206	0.7	2.1	182
12/22/2023 16:00	0.2	4.2	160	0.6	2.1	171	0.7	2.1	183
12/22/2023 16:30	0.2	3.9	144	0.6	1.5	133	0.5	1.5	179
12/22/2023 17:00	0.2	2.0	150	0.5	0.7	117	0.7	1.1	190
12/22/2023 17:30	0.2	2.3	196	0.4	0.4	106	1.0	0.4	242
12/22/2023 18:00	0.2	2.1	195	0.4	0.7	142	1.2	0.4	254
12/22/2023 18:30	0.2	2.7	208	0.5	0.8	90	0.9	0.4	271
12/22/2023 19:00	0.2	2.0	197	0.5	0.6	153	0.9	0.3	233
12/22/2023 19:30	0.2	1.5	193	0.4	0.5	36	1.0	0.3	75
12/22/2023 20:00	0.2	1.8	202	0.5	0.5	172	1.6	0.4	13
12/22/2023 20:30	0.2	1.3	202	0.5	0.3	72	1.1	0.2	101
12/22/2023 21:00	0.2	1.4	206	0.6	0.2	294	1.6	0.3	16
12/22/2023 21:30	0.2	1.2	191	0.6	0.3	357	1.6	0.2	351
12/22/2023 22:00	0.2	1.4	184	0.8	0.2	28	2.0	0.3	15
12/22/2023 22:30	0.2	1.9	199	1.3	0.3	264	2.7	0.2	353
12/22/2023 23:00	0.2	1.4	193	1.4	0.4	42	3.3	0.3	328
12/22/2023 23:30	0.2	2.1	204	1.3	0.3	359	2.6	0.2	297
12/23/2023 0:00	0.2	1.7	198	1.6	0.3	266	3.2	0.2	285

AQS Null Data Codes				
Qualifier Code	Item Description			
AB	TECHNICIAN UNAVAILABLE			
AC	CONSTRUCTION/REPAIRS IN AREA			
AD	SHELTER STORM DAMAGE			
AE	SHELTER TEMPERATURE OUTSIDE LIMITS			
AI	INSUFFICIENT DATA (CAN'T CALCULATE)			
AM	MISCELLANEOUS VOID			
AN	MACHINE MALFUNCTION			
AO	BAD WEATHER			
AP	VANDALISM			
AS	POOR QUALITY ASSURANCE RESULTS			
AT	CALIBRATION			
AU	MONITORING WAIVED			
AV	POWER FAILURE (POWR)			
AW	WILDLIFE DAMAGE			
AX	PRECISION CHECK (PREC)			
AY	Q C CONTROL POINTS (ZERO/SPAN)			
AZ	Q C AUDIT (AUDT)			
BA	MAINTENANCE/ROUTINE REPAIRS			
BB	UNABLE TO REACH SITE			
BC	MULTI-POINT CALIBRATION			
BD	AUTO CALIBRATION			
BE	BUILDING/SITE REPAIR			
BF	PRECISION/ZERO/SPAN			
BJ	OPERATOR ERROR			
BK	SITE COMPUTER/DATA LOGGER DOWN			
EC	EXCEED CRITICAL CRITERIA			