# **Air Monitoring Summary Tables**

The table below summarizes monitoring data collected using a portable wireless remote monitoring system. All times in Eastern Standard Time (EST).

#### *From:* 11/21/23 12:00 am

11/21/23 11:59 pm

**Offsite Monitors** 

Instrument	Analyte	ATSDR MRL 14-day Avg Reached?	Concentration Range Detected <sup>a</sup>	24-hr Average <sup>a</sup>	7-day Average	ATSDR 14-day MRL	
Catawba Headstart							
Acrulog PPB	$H_2S$	No	0 - 0 ppb	0.00 ppb	0.00 ppb	70 ppb	
Treetops							
Acrulog PPB	$H_2S$	No	0 - 0 ppb	0.00 ppb	0.00 ppb	70 ppb	
Liberty Hill							
Acrulog PPB	$H_2S$	No	0 - 0 ppb	0.00 ppb	0.00 ppb	70 ppb	
<b>Riverchase Estat</b>	Riverchase Estates						
Acrulog PPB	$H_2S$	No	0-0 ppb	0.00 ppb	0.08 ppb	70 ppb	
Millstone Creek							
Acrulog PPB	$H_2S$	No	0 - 0 ppb	0.00 ppb	0.01 ppb	70 ppb	

To:

#### **Onsite Fenceline Monitors**


Instrument	Analyte	30-min AEGL Reached?	Concentration Range Detected <sup>a</sup>	24-hr Average <sup>a</sup>		30-min AEGL	
Station 1							
TAPI Analyzer	$H_2S$	No	0 – 10 ppb	2.51 ppb	3.69 ppb	600 ppb	
Station 2							
TAPI Analyzer	$H_2S$	No	1– 7 ppb	1.04 ppb	0.64 ppb	600 ppb	
Station 3							
TAPI Analyzer	$H_2S$	No	0 – 3 ppb	0.67 ppb	0.45 ppb	600 ppb	

<sup>a</sup> Based on 30-minute averages.

Notes:

ATSDR MRL	Agency for Toxic Substances and Disease Registry Minimal Risk Level (MRL)
AEGL	EPA Acute Exposure Guidelines Levels
$H_2S$	Hydrogen Sulfide
TAPI	Teledyne API H <sub>2</sub> S Analyzer
hr	Hour
min	Minute
ppb	Parts per billion
MRL Limit	Limit defined as a 14-day average value.

Station 1 Wind Rose – Shows the direction the wind is coming from, the monitoring station being at the center of the rose.

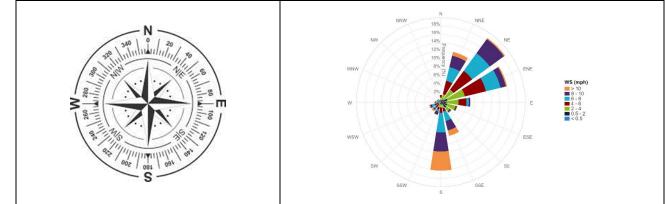




## Period H<sub>2</sub>S Monitoring Hydrogen Sulfide Offsite Monitors


Below are graphs for offsite locations where hydrogen sulfide  $(H_2S)$  was detected during the current reporting period.


The five stand-alone  $H_2S$  monitoring stations correlate with five previous EPA's Viper monitoring system which includes areas to the north-northeast and south-southwest of the New-Indy Catawba Mill.


Winds were coming from a variable direction throughout the day at 1 to 10 mph.


See wind rose diagram with aerial map figure for full wind data during this reporting period.

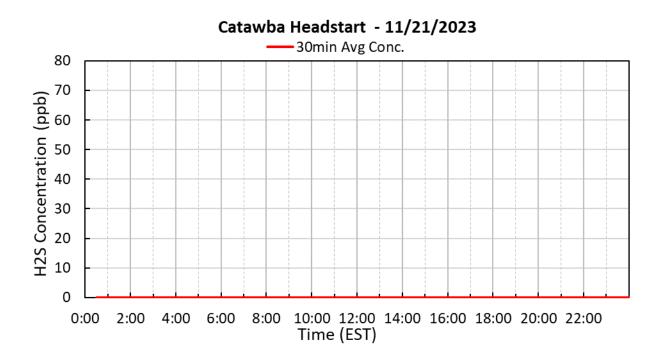

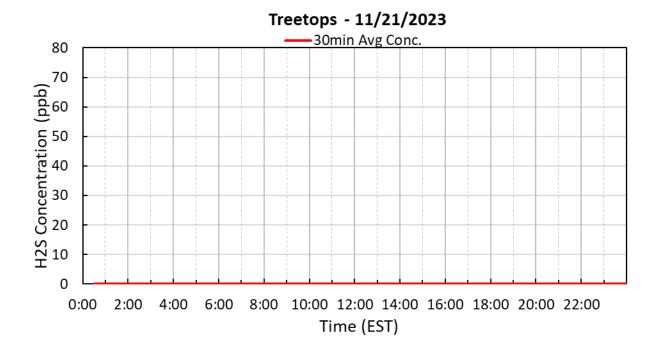

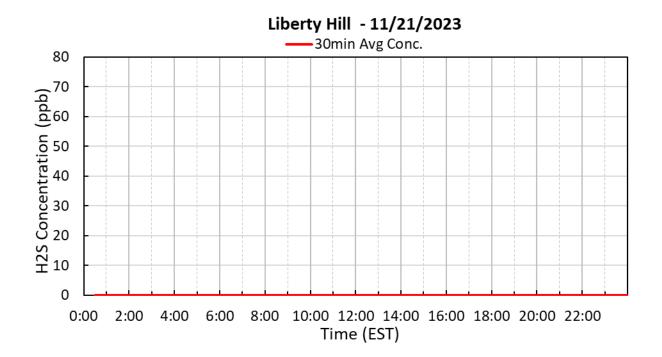

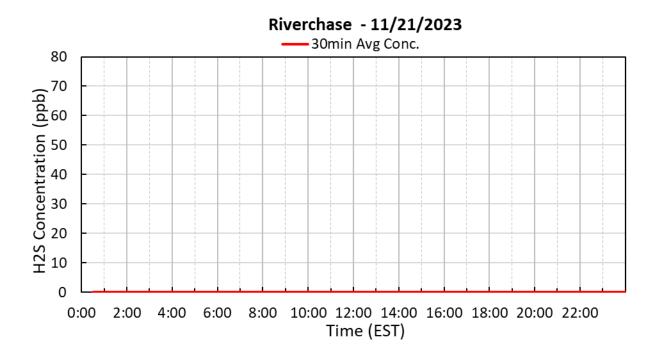

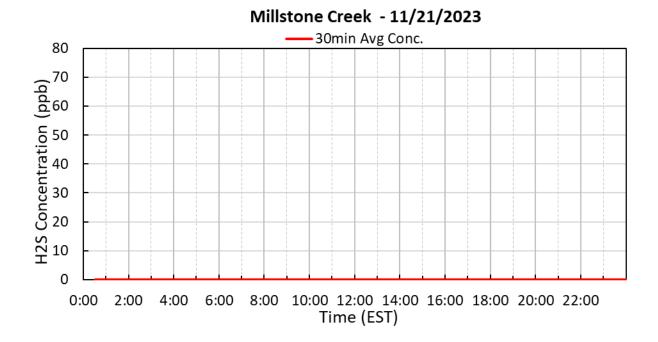


## Period H<sub>2</sub>S Monitoring Hydrogen Sulfide Onsite Monitors


Below are graphs for onsite locations during the current reporting period.

Depending on wind direction, the  $H_2S$  measured at the onsite fence line locations may not exit the mill property at reported concentrations. Wind directions from offsite locations, blowing onto mill property, will disperse ambient concentrations to lower levels prior to exiting the plant site.

Winds were coming from a variable direction throughout the day at 1 to 10 mph.

See wind rose diagram with aerial map figure for full wind data during this reporting period.

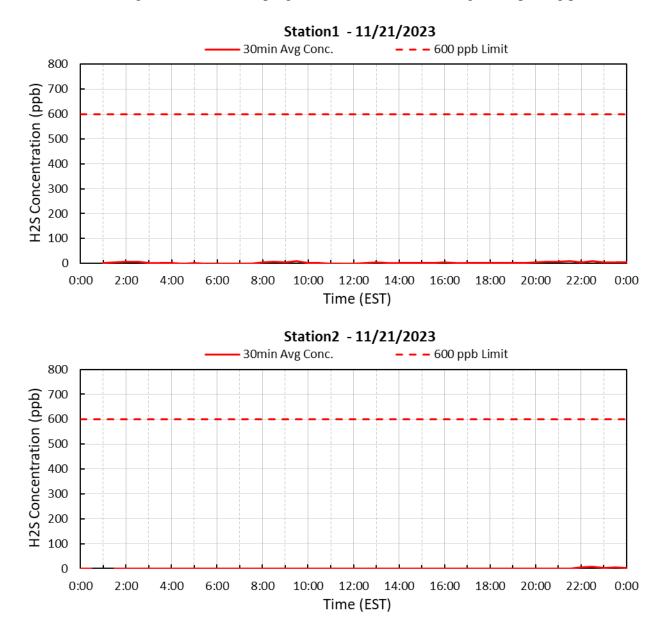

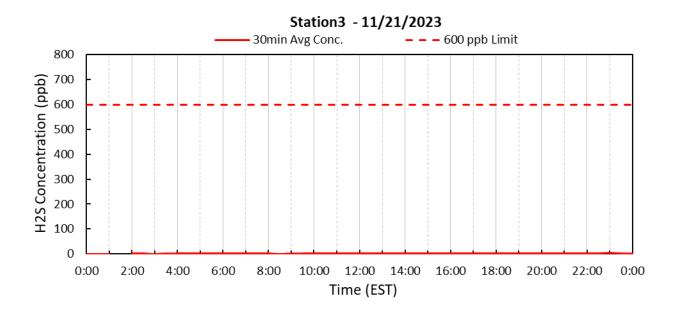

	Station 1		Station 2			Station 3			
30-Minute Avgs	H2S Met		H2S Met			H2S Met			
11/21/2023	30min Avg H2S Conc.	30min Avg WS	30min Avg WD	30min Avg H2S Conc.	30min Avg WS	30min Avg WD	30min Avg H2S Conc.	30min Avg WS	30min Avg WD
Date / Time	ppb	mph	degrees	ppb	mph	degrees	ppb	mph	degrees
11/21/2023 0:30	AX	7.3	74	0.5	2.3	77	0.4	3.2	66
11/21/2023 1:00	0.4	6.0	57	AX	1.8	38	0.2	2.7	45
11/21/2023 1:30	3.6	6.6	29	0.8	0.9	21	AX	1.9	4
11/21/2023 2:00	7.0	8.2	28	0.6	1.6	33	0.7	2.3	. 11
11/21/2023 2:30	7.4	7.3	30	0.6	1.6	34	0.5	2.2	16
11/21/2023 3:00	1.3	9.8	34	0.5	1.8	50	0.4	2.6	35
11/21/2023 3:30	0.9	7.9	37	0.5	1.3	50	0.5	2.5	41
11/21/2023 4:00	0.6	7.7	50	0.5	1.6	56	0.5	2.3	46
11/21/2023 4:30	0.2	7.5	57	0.5	1.7	49	0.6	2.2	47
11/21/2023 5:00	0.4	7.0	57	0.5	1.5	58	0.6	2.6	52
11/21/2023 5:30	0.2	7.0	60	0.6	1.4	56	0.5	3.3	67
11/21/2023 6:00	0.2	5.3	73	0.6	1.4	57	0.5	2.4	76
11/21/2023 6:30	0.2	3.9	87	0.6	1.6	67	0.5	2.5	94
11/21/2023 7:00	0.2	1.9	119	0.6	0.7	329	0.6	0.9	316
11/21/2023 7:30	0.2	2.2	51	0.6	1.1	27	0.5	0.7	22
11/21/2023 8:00	4.6	5.4	21	0.6	2.1	10	0.5	1.5	357
11/21/2023 8:30	7.0	6.2	37	0.6	1.2	50	0.4	1.6	47
11/21/2023 9:00	3.3	5.4	36	0.6	1.8	16	0.6	1.4	10
11/21/2023 9:30	8.2	6.2	29	0.6	1.7	33	0.6	1.4	27
11/21/2023 10:00	0.9	3.8	53	0.6	0.7	49	0.6	1.1	60
11/21/2023 10:30	0.6	4.5	55	0.6	1.0	39	0.6	1.5	47
11/21/2023 11:00	0.2	4.6	64	0.6	1.3	57	0.7	2.5	68
11/21/2023 11:30	0.2	3.4	75	0.6	1.2	58	0.7	1.8	78
11/21/2023 12:00	0.2	1.4	69	0.7	1.1	2	0.7	1.0	7
11/21/2023 12:30	0.6	2.4	39	0.7	1.5	12	0.6	1.1	359
11/21/2023 13:00	3.4	5.2	36	0.7	1.6	45	0.7	1.4	45
11/21/2023 13:30	0.8	2.6	103	0.6	1.0	79	0.6	1.0	86
11/21/2023 14:00	0.6	2.0	63	0.7	1.1	37	0.6	0.8	21
11/21/2023 14:30	0.6	1.9	122	0.7	1.4	104	0.7	1.0	152
11/21/2023 15:00	0.5	1.8	137	0.8	1.6	116	0.7	1.1	155
11/21/2023 15:30	0.5	3.8	142	0.8	2.1	122	0.6	2.4	155
11/21/2023 16:00	3.0	3.4	39	0.8	1.9	294	0.7	1.0	217
11/21/2023 16:30	0.4	6.3	175	0.7	2.5	190	0.8	1.8	180
11/21/2023 17:00	0.4	7.3	172	0.6	4.2	190	0.6	3.3	182
11/21/2023 17:30	0.6	8.4	175	0.6	4.6	197	0.6	3.8	194
11/21/2023 18:00	0.8	8.3	177	0.6	4.6	193	0.5	3.9	191
11/21/2023 18:30	1.3	7.9	170	0.6	5.2	188	0.6	3.4	190
11/21/2023 19:00	1.7	8.9	169	0.7	4.4	180	0.5	3.9	182
11/21/2023 19:30	1.6	10.2	174	0.6	4.7	189	0.5	4.5	187
11/21/2023 20:00	4.8	9.6	172	0.7	5.0	190	0.6	4.2	182
11/21/2023 20:30	6.5	9.7	179	0.7	5.9	196	0.7	4.2	196
11/21/2023 21:00	7.1	9.0	183	0.7	5.6	203	0.8	4.4	204
11/21/2023 21:30	9.1	9.0	171	0.8	5.2	186	0.7	3.6	194
11/21/2023 22:00	5.1	9.2	224	4.1	8.0	227	1.2	3.5	255
11/21/2023 22:30	10.3	4.2	214	6.7	3.8	217	1.4	2.3	241
11/21/2023 23:00	3.1	5.8	260	3.5	3.9	255	3.3	1.4	289
11/21/2023 23:30	3.6	4.7	241	6.2	5.4	255	0.7	1.5	257
11/22/2023 0:00	3.5	4.8	282	1.8	4.8	272	0.6	1.1	279

### Submitted Fenceline H<sub>2</sub>S and Met 30-minute Data

AQS Null Data Codes					
Qualifier	Item Description				
Code					
AB	TECHNICIAN UNAVAILABLE				
AC	CONSTRUCTION/REPAIRS IN AREA				
AD	SHELTER STORM DAMAGE				
AE	SHELTER TEMPERATURE OUTSIDE LIMITS				
AI	INSUFFICIENT DATA (CAN'T CALCULATE)				
AM	MISCELLANEOUS VOID				
AN	MACHINE MALFUNCTION				
AO	BAD WEATHER				
AP	VANDALISM				
AS	POOR QUALITY ASSURANCE RESULTS				
AT	CALIBRATION				
AU	MONITORING WAIVED				
AV	POWER FAILURE (POWR)				
AW	WILDLIFE DAMAGE				
AX	PRECISION CHECK (PREC)				
AY	Q C CONTROL POINTS (ZERO/SPAN)				
AZ	Q C AUDIT (AUDT)				
BA	MAINTENANCE/ROUTINE REPAIRS				
BB	UNABLE TO REACH SITE				
BC	MULTI-POINT CALIBRATION				
BD	AUTO CALIBRATION				
BE	BUILDING/SITE REPAIR				
BF	PRECISION/ZERO/SPAN				
BJ	OPERATOR ERROR				
BK	SITE COMPUTER/DATA LOGGER DOWN				
EC	EXCEED CRITICAL CRITERIA				